
AF27.35-U-6101A	No 2-3 Upshift with Full Throttle or Kickdown, Engine reaches cutout point	1.8.83
-----------------	--	--------

TRANSMISSION all

Damage code	Cause	Remedy	
No code available		Check kick-down solenoid valve, kick-down switch and fuel pump relay. Replace parts as required. Adjust control valve full throttle set screw (arrow) approx. 1-2 turns in clockwise direction.	

Figure 1

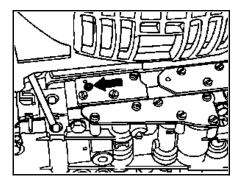

P27.35-0230-01