
## No 1-2 or 2-3 upshift with full throttle or kickdown (engine regulates speed in advance).

ΑII

## Cause/remedy:

1. Turn grub screw (arrow) approx. 1 turn clockwise.

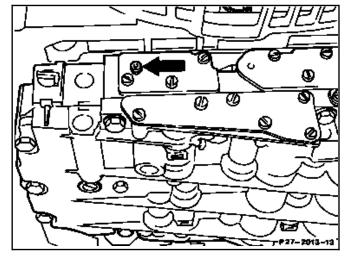

P27-2013-13